BARRY HONEYSETT

Consulting Structural & Civil Engineers


Bathurst House, Smythen Street Exeter, Devon, EX1 1BN Tel +44/01 392 272510 Project
EAST WORLINGTON PARISH HALL
for East Worlington Parish Hall Management
Committee

Title

REMEDIAL WORKS - DETAILS of STICHING CRACK in COB WALLS

1	Drawn by	Checked by
l	ВІН	BIH
1	Date	Scale
	August 2015	1/10
1	Project No.	Drawing No.
	14201	SK2

8mm dia Helibar driven diagonally into cob and across crack, in pairs at max 450 crs along length of crack. Helibar length = 1000 approx. 'Helibar' is to be nominal 8mm diameter helical twist bar, grade 304 stainless steel, as manufactured by Helifix Ltd (0208 735 5200)

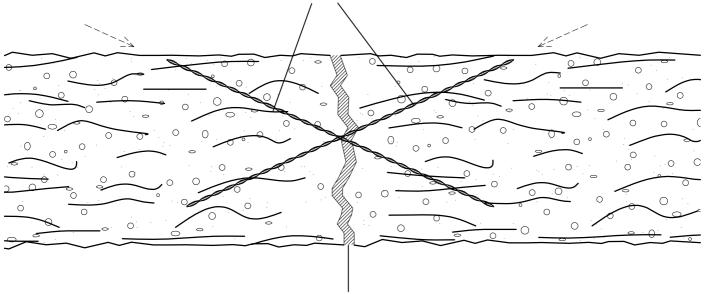

Crack to be raked out and filled with lime putty or hydraulic lime mortar. If cracks exceed 25mm width fill with pieces of broken brick or clay tile in lime mortar.